

GOWIN TKS200 Settings For Use with LaserLynx

Hold the F2 Key while pressing the Power Button

Set Units to Meters

Press F1 - Unit Set

F3 - Distance

F1 - m

F4 - enter

Press ESC

Set Power On Mode to Distance Measurement

Press F2 - Mode Set

F1 - Power On Mode

F2 - Distance Meas.

F4 - enter

Set N-Times / Repeat

F4 (down arrow)

F2- N-Times / Repeat

F1 -N-Times

F4 - Enter

Press ESC

Set C R , L F ON

Press F3 - Others Set

F4 - (down arrow)

F3 - CR, LF

F1 - On

F4 - Enter

Press esc

Power the unit off

Set Communications Settings

Press the Power Button

Press - Menu

F4 - (down arrow)

F4 - (down arrow)

F1 - Parameters

F4 - (down arrow)

F1 -RS232

F1 - Baud

Use Left Arrow button to select 9600

F4 - Enter

F2 - Char / Parity

F3 - 8/None

F4 - Enter

F3 - Stop Bits

F1 - 1

F4 - Enter

ESC

ESC

ESC

Set Prism Constant to -30.0mm

F3 - S/A

F1 - PRISM

Set Prism Const, to -30.0mm

F4- Enter

ESC

Set Up Field Lynx: If using FieldLynx software, proceed to the appropriate FieldLynx Quick Start Guide.

FieldLynx Not Available? Follow the GOWIN "Missing Line Measurement" Guideline.